Thin type universal isolate transducer MODEL TH-2M, 5M INSTRUCTION MANUAL



This marking indicates that the erroneous operation of converter may result in death or serious injury.



Caution

- (1) The application of voltage or current exceeding its maximum allowable value to the input terminals may result in instrument damage.
- (2) The supply of power out of its allowable range may cause fire, electric shock or instrument failure.
- (3) The content of this manual may subject to change without prior notice for product improvement.
- (4) This manual is carefully prepared. However, if any question arises, or any mistake, omission or suggestion is found in the content of this manual, contact your nearest our sales agent.
- (5) Keep this manual available easily anytime.

■Outline

This is a transducer housed in a thin case which converts a DC voltage and current input signal into the corresponding DC voltage or current output signal.

The input/output can be changed by input/output setting dip switches.

In addition, the three ports of input, output and power are mutually isolated. The case can be mouted on a DIN rail in one touch.

■Model NO. configuration

Each code and the standard specifications of this converter are as follows. First check whether or not your desired specifications are correct by comparing them to the following specifications. Example: TH-5M



■Input specification

Input	Input resistance	Input allowable range
0 to 5V DC	More than $1 \text{M} \Omega$	-50 to +150%F.S
1 to 5V DC		
0 to 10V DC		
0 to 0.06V DC		
4 to 20mA DC	250 Ω	
0 to 20mA DC	200 ₩	

■Output specification

Output	Load resistance	
0 to 5V DC		
1 to 5V DC		
0 to 10V DC		
-2 to 2V DC	V +h 01- O	
-2.5 to 2.5V DC	More than $2 \mathrm{k} \Omega$	
-5 to 5V DC		
-10 to 10V DC		
0 to 4V DC		
4 to 20mA DC	Less than 550Ω	

■General specifications

Range setting before shipment: Input; 1 to 5V, Output; 4 to 20mA

Error caused by input range setting change: $\pm 1\%$ F.S Error caused by output range setting change: $\pm 1\%$ F.S

Range setting for -5 to 5V, -10 to 10V: $\pm 2\%$ F.S Base accuracy: $\pm 0.1\%$ F.S(at $25\pm 2\%$)

Load resistance variation: $\pm 0.06\%$ F.S Power supply variation: $\pm 0.06\%$ F.S Temperature characteristic: $\pm 0.02\%$ F.S/°C

Response time: Less than 50msec TYP (At AC power, 0 \rightarrow 90%) Response time: Less than 10msec TYP (At DC power, 0 \rightarrow 90%)

Front adjustments: ±5%F.S (zero, span)

Insulation resistance: Between the input and output/power supply

More than $100\text{M}\,\Omega$ at 500V DC

Dielectric strength: Between the input and output/power supply

For 1 min. at 1500V AC

Power supply voltage: 100 to 240V AC $\pm 10\%$

24V DC $\pm 10\%$

Consuming current: Less than 30mA (at 100V AC)

Less than 60mA (at 24V DC)

Operating ambient temperature: -5 to 50℃

Operating ambient humidity: Less than 90%RH (No-condensing)

Storage temperature: Within -10 to $+70^{\circ}\mathrm{C}$

Storage humidity: Less than 60%RH (No-condensing)

Case material: Black PC 94V-2

Weight: Approx. 80g

Applicable standards: TH-5M(24V DC POWER)

EN61326-1 EMI: Class A

EMS: Industrial locations

Transducer is applied to standard by the input and output signal line length less

than 30m. EN IEC 63000

■Changing input/output range

Prior to factory shipment, the input is set 1 to 5V and the output, 4 to 20mA. The input/output range can be changed by dip swiches on the side of the transducer.

Always set or change the input/output range with the power turned off.


After finishing the changing, stick the attached seal to the window for dip switch operation.

1. Changing input range

	SW1	SW2
0~5V	OFF	
1~5V		
0~10V		
0~60mV		
4~20mA		
0~20mA		
	1234	12345678

(Range setting before shipment)

2. Changing output range

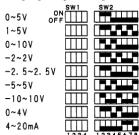


(Range setting before shipment)


3. ZERO, SPAN adjustments

When range change is performed, ZERO and SPAN adjustment are $\underbrace{\text{performed.}}$


■Block diagram

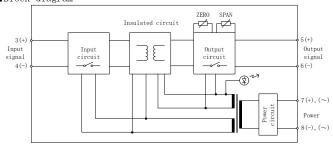


■Dimensions Front view

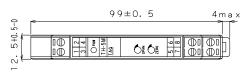


Side view

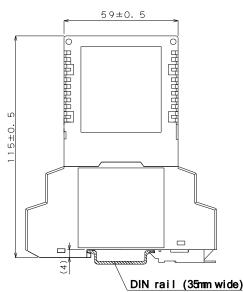


■Input/output connection diagram

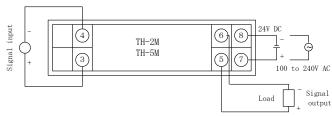


 $\hfill \Lambda$ Note: When conducting wiring, be careful with its polarity. Note: Please be careful of the kind of power supply.

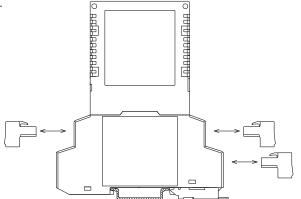

 \blacksquare Recommended treatment of wires connected to connector type terminal board

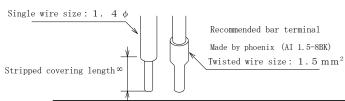


- Mounting or dismounting
 - Mounting
 - 1. Engage the upper side of the transducer with the rail. 2. Push the lower side of the transducer into the rail.

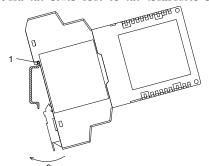

Note: If each transducer is dislocated after being mounted, it is recommended than and clamps be used (such as E/NS35N made by Phoenix/Contact, etc.)

- Dismounting
 - 1. Push down the slider using a screwdriver.
 - Pull the transducer toward you, then disengage the lower side of transducer from the rail.
 - $2.\,\mathrm{Disengage}$ the upper side of the transducer from the rail.

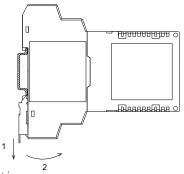

■Caution

- 1)Store the transducer at a location having a storage temperature of -10 to +70°C and a humidity of less than 60% RH.
- 2)Use the transducer at a location where there are no chemicals or gases harmful to its electrical parts or there is no dust.
- 3)Do not apply any vibration or impact to the transducer.
- 4) In order to lessen the effect of noise, etc., do not bundle the input/output wires with the power supply wires, nor put these wires in the same duct.
- Other measures for reducing noise use shield lines.
- 5)The unit is designed to function as soon as power is supplied, however, a warm up for 30 minutes is required for satisfying complete performance described in the data sheet.

■Warrantv

This transducer is warranted for a period of one year from date of delivery. Any defect which occurs in this period and is undoubtedly coused by Watanabe Electric Industry faults will be remedied free of charge. This warranty dose not apply to the transducer showing abuse or damage which has been aitered or repaired by others except as authorized by Watanabe Electric Industry.

■After-sale service

This transducer is delivered after being manufactured, tested and inspected under strict quality control. However, if any problem dose occur, contact your nearest Watanabe Electric Industry sales agent or Watanabe Electric Industry directly giving as much information on problem as possible.

■ Accessorise

Dip switch seal: 1 sheet

Power cable connection clamps: 2pcs.

Use them when two or more transducers are connected.



watanabe

WATANABE ELECTRIC INDUSTRY CO., LTD.

6-16-19, Jingumae, Shibuya-ku, Tokyo 150-0001, Japan Phone: (81)3-3400-6141

Homepage http://www.watanabe-electric.co.jp/en/